

Document Information Form

Mine Number: C1007/001

File Name: Internal

To: DOGM

From:

Person N/A

Company Valley Camp

Date Sent: N/A

Explanation:

Inspection Report

cc:

File in: C1007/001, 1991, Internal

Refer to:

- Confidential
- Shelf
- Expandable

Date _____ For additional information



State of Utah

DEPARTMENT OF NATURAL RESOURCES
DIVISION OF OIL, GAS AND MINING

John DGH

Norman H. Bangertter
Governor
Dee C. Hansen
Executive Director
Dianne R. Nielson, Ph.D.
Division Director

355 West North Temple
3 Triad Center, Suite 350
Salt Lake City, Utah 84180-1203
801-538-5340

INSPECTION REPORT

INSPECTION DATE & TIME: 8/13/91
3:00 pm to 6:00 pm

Permittee and/or Operator's Name: Valley Camp
Business Address: Scofield Route Helper Ut. 84526
Mine Name: Belina Complex Permit Number: Act 007/001
Type of Mining Activity: Underground Surface Other
County: Carbon Company Official(s): Steve Tanner
State Officials(s): Priscilla Burton
Federal Official(s): none
Partial: x Complete
Date of last Inspection: 8/8/91
Weather Conditions: Unsettled, scattered showers, 70's
Acreage: Permitted 3136 Disturbed 79 Regraded Seeded
Bonded 79 Enforcement Action: yes

COMPLIANCE WITH PERMITS AND PERFORMANCE STANDARDS

	YES	NO	N/A	COMMENTS
1. PERMITS	()	()	()	()
2. SIGNS AND MARKERS	()	()	()	()
3. TOPSOIL	()	()	()	()
4. HYDROLOGIC BALANCE:				
a. STREAM CHANNEL DIVERSIONS	()	()	()	()
b. DIVERSIONS	()	(x)	()	(x)
c. SEDIMENT PONDS AND IMPOUNDMENTS	()	(x)	()	(x)
d. OTHER SEDIMENT CONTROL MEASURES	()	(x)	()	(x)
e. SURFACE AND GROUNDWATER MONITORING	()	()	()	()
f. EFFLUENT LIMITATIONS	()	()	()	()
5. EXPLOSIVES	()	()	()	()
6. DISPOSAL OF DEVELOPMENT WASTE & SPOIL	()	()	()	()
7. COAL PROCESSING WASTE	()	()	()	()
8. NONCOAL WASTE	()	()	()	()
9. PROTECTION OF FISH, WILDLIFE AND RELATED ENVIRONMENTAL VALUES	()	()	()	()
10. SLIDES AND OTHER DAMAGE	()	()	()	()
11. CONTEMPORANEOUS RECLAMATION	()	()	()	()
12. BACKFILLING AND GRADING	()	()	()	()
13. REVEGETATION	()	()	()	()
14. SUBSIDENCE CONTROL	()	()	()	()
15. CESSATION OF OPERATIONS	()	()	()	()
16. ROADS				
a. CONSTRUCTION	()	()	()	()
b. DRAINAGE CONTROLS	()	()	()	()
c. SURFACING	()	()	()	()
d. MAINTENANCE	()	()	()	()
17. OTHER TRANSPORTATION FACILITIES	()	()	()	()
18. SUPPORT FACILITIES	()	()	()	()
UTILITY INSTALLATIONS	()	()	()	()

File in:

- Confidential
- Shelf
- Expandable

Refer to Record No 0001 Date _____

In CI 007/001, 1991, Internal

For additional information



State of Utah

DEPARTMENT OF NATURAL RESOURCES
DIVISION OF OIL, GAS AND MINING

John DGH

Norman H. Bangerter
Governor
Dee C. Hansen
Executive Director
Dianne R. Nielson, Ph.D.
Division Director

355 West North Temple
3 Triad Center, Suite 350
Salt Lake City, Utah 84180-1203
801-538-5340

INSPECTION REPORT

INSPECTION DATE & TIME: 8/13/91
3:00 pm to 6:00 pm

Permittee and/or Operator's Name: Valley Camp
Business Address: Scofield Route Helper Ut. 84526
Mine Name: Belina Complex Permit Number: Act 007/001
Type of Mining Activity: Underground Surface Other
County: Carbon Company Official(s): Steve Tanner
State Officials(s): Priscilla Burton
Federal Official(s): none
Partial: x Complete
Date of last Inspection: 8/8/91
Weather Conditions Unsettled, scattered showers, 70's
Acreage: Permitted 3136 Disturbed 79 Regraded Seeded
Bonded 79 Enforcement Action: yes

COMPLIANCE WITH PERMITS AND PERFORMANCE STANDARDS

	YES	NO	N/A	COMMENTS
1. PERMITS	()	()	()	()
2. SIGNS AND MARKERS	()	()	()	()
3. TOPSOIL	()	()	()	()
4. HYDROLOGIC BALANCE:				
a. STREAM CHANNEL DIVERSIONS	()	()	()	()
b. DIVERSIONS	()	(x)	()	(x)
c. SEDIMENT PONDS AND IMPOUNDMENTS	()	(x)	()	(x)
d. OTHER SEDIMENT CONTROL MEASURES	()	(x)	()	(x)
e. SURFACE AND GROUNDWATER MONITORING	()	()	()	()
f. EFFLUENT LIMITATIONS	()	()	()	()
5. EXPLOSIVES	()	()	()	()
6. DISPOSAL OF DEVELOPMENT WASTE & SPOIL	()	()	()	()
7. COAL PROCESSING WASTE	()	()	()	()
8. NONCOAL WASTE	()	()	()	()
9. PROTECTION OF FISH, WILDLIFE AND RELATED ENVIRONMENTAL VALUES	()	()	()	()
10. SLIDES AND OTHER DAMAGE	()	()	()	()
11. CONTEMPORANEOUS RECLAMATION	()	()	()	()
12. BACKFILLING AND GRADING	()	()	()	()
13. REVEGETATION	()	()	()	()
14. SUBSIDENCE CONTROL	()	()	()	()
15. CESSATION OF OPERATIONS	()	()	()	()
16. ROADS				
a. CONSTRUCTION	()	()	()	()
b. DRAINAGE CONTROLS	()	(x)	()	(x)
c. SURFACING	()	()	()	()
d. MAINTENANCE	()	()	()	()
17. OTHER TRANSPORTATION FACILITIES	()	()	()	()
18. SUPPORT FACILITIES				
UTILITY INSTALLATIONS	()	()	()	()

INSPECTION REPORT

(Continuation sheet)

Page 2 of 3

PERMIT NUMBER: ACT/007/001

DATE OF INSPECTION: 8/13/91

(Comments are Numbered to Correspond with Topics Listed Above)

The purpose of this inspection was to deliver the Notice of Violation 91-38-2-2 written by Inspector Falvey on August 13, 1991 after her inspection on August 8, 1991, and to note the progress that Valley Camp had made towards rectifying the violations noted.

4. Hydrologic Balance

b) Diversions

Approximately 20 feet of culvert C-33-24, the inlet to sediment pond 004, had been removed. Mr. Tanner indicated that two collars on this culvert were leaking. Valley Camp plans to replace the culvert; this time, orienting the outlet in a southeasterly direction. So that, the flow from the upper pad will enter the pond at approximately the same location as C-34-24 (see Map R614-301-731.720d Sediment Control Belina Mine).

Using a trackhoe, Valley Camp plans to dredge the sediment that has accumulated at the base of C-33-24. The material will be placed back upon the slope. After this work is completed, the outlet of C-34-24 will be reconstructed. Presently, the outlet of C-34-24 is being used for access to C-33-24.

At the time of the inspection, the inlet at the southeast of the pond was still in need of stabilizaton. The inlet remained functional, however.

c) Sediment Ponds And Impoundments

The water surface of pond 004 is approximately 8 inches from the principal spillway and 16 inches from the top of the oil skimmer. Mr. Tanner indicated that every third year Valley Camp checks the sediment level. This year the sediment level will be checked with a rod.

d) Other Sediment Control Measures

The straw bales placed along drainage D-21 (see map R614-301-521.150 Haulroad), between the haulroad and Eccles Creek, were filled with sediment. New bales had been placed on top of the old bales, but the channel had not been cleared of sediment. The bales had not yet been anchored.

INSPECTION REPORT

(Continuation sheet)

Page 3 of 3

PERMIT NUMBER: ACT/007/001

DATE OF INSPECTION: 8/13/91

(Comments are Numbered to Correspond with Topics Listed Above)

Valley Camp has replaced straw bales in the Belina Complex around Pond 004, the topsoil pile, and the undisturbed drainage around the site. Mr. Tanner indicated that maintenance crews are working their way down the canyon.

16. Roads

b) Drainage Controls

Mr. Tanner indicated that Valley Camp has solicited bids for the repair of the haulroad cement and plans to replace the damaged sections.

Copy of this Report:

Mailed to: Brian Smith, OSM; Steve Tanner, Valley Camp

Given to: Joe Helfrich and Daron Haddock, DOGM

Inspector's Signature & Number:  #37

Date: 8/20/91