



State of Utah
DEPARTMENT OF NATURAL RESOURCES
DIVISION OF OIL, GAS AND MINING

INSPECTION REPORT

Michael O. Leavitt
Governor
Ted Stewart
Executive Director
James W. Carter
Division Director

355 West North Temple
3 Triad Center, Suite 350
Salt Lake City, Utah 84180-1203
801-538-5340
801-359-3940 (Fax)
801-538-5319 (TDD)

Partial: XXX Complete: Exploration:
Inspection Date & Time: 6/5/96 / 1:30p.m.-5:00p.m.
Date of Last Inspection: 5/9/96

Mine Name: Sunnyside Mine County: Carbon Permit Number: ACT/007/007
Permittee and/or Operator's Name: Ken Rushton, Trustee
Business Address: 99 West Main, P.O. Box 212, Lehi, Utah 84043
Type of Mining Activity: Underground Surface Prep. Plant Other XXX
Company Official(s):
State Officials(s): Peter Hess Federal Official(s):
Weather Conditions: Sunny, Warm, 80's
Existing Acreage: Permitted- 14475 Disturbed- 310 Regraded- Seeded- Bonded- 310
Increased/Decreased: Permitted- Disturbed- Regraded- Seeded- Bonded-
Status: Exploration/ Active/ XXX Inactive/ Temporary Cessation/ Bond Forfeiture
Reclamation (Phase I/Phase II/Final Bond Release/ Liability Year)

REVIEW OF PERMIT, PERFORMANCE STANDARDS & PERMIT CONDITION REQUIREMENTS

Instructions

- 1. Substantiate the elements on this inspection by checking the appropriate performance standard.
a. For complete inspections provide narrative justification for any elements not fully inspected unless element is not appropriate to the site, in which case check N/A.
b. For partial inspections check only the elements evaluated.
2. Document any noncompliance situation by referencing the NOV issued at the appropriate performance standard listed below.
3. Reference any narratives written in conjunction with this inspection at the appropriate performance standard listed below.
4. Provide a brief status report for all pending enforcement actions, permit conditions, Division Orders, and amendments.

Table with 5 columns: Item, EVALUATED, N/A, COMMENTS, NOV/ENF. Rows include categories like PERMITS, CHANGE, TRANSFER, RENEWAL, SALE; SIGNS AND MARKERS; TOPSOIL; HYDROLOGIC BALANCE; EXPLOSIVES; DISPOSAL OF EXCESS SPOIL/FILLS/BENCHES; COAL MINE WASTE/REFUSE PILES/IMPOUNDMENTS; NONCOAL WASTE; PROTECTION OF FISH, WILDLIFE AND RELATED ENVIRONMENTAL VALUES; SLIDES AND OTHER DAMAGE; CONTEMPORANEOUS RECLAMATION; BACKFILLING AND GRADING; REVEGETATION; SUBSIDENCE CONTROL; CESSATION OF OPERATIONS; ROADS; OTHER TRANSPORTATION FACILITIES; SUPPORT FACILITIES/UTILITY INSTALLATIONS; AVS CHECK; AIR QUALITY PERMIT; BONDING & INSURANCE.



**INSPECTION REPORT**  
(Continuation sheet)

Page 2 of 2

PERMIT NUMBER: ACT/007/007

DATE OF INSPECTION: 6/5/96

(Comments are Numbered to Correspond with Topics Listed Above)

4a. HYDROLOGIC BALANCE: DIVERSIONS

The 18 inch CMP which lies under the County road and drains the Whitmore fan BTCA area is nearly closed off from sediment buildup at the discharge end. This flow parallels the road on the north side before it supposedly drops into Grassy Trail Creek. The grade here is insufficient to prevent sediment buildup, hence, this was always a high maintenance item, even when the Mine was operating. This culvert was an issue in several "failure to maintain diversions" Notices of Violation.

4c. HYDROLOGIC BALANCE: OTHER SEDIMENT CONTROL MEASURES

The following silt fences need to be repaired to keep the site in compliance with the R645 regulations.

- 1) the silt fence which surrounds the inlet of the 18 inch CMP mentioned above.
- 2) the silt fence which treats the parking area/turnaround on the north side of the Sunnyside surface facilities pond.
- 3) the silt fence located along the western access road to #2 Canyon, (east side of Twin Tanks).
- 4) the fences at the SW and SE corners of the Roadside substation.
- 5) the silt fence at the Manshaft substation BTCA area.
- 6) silt fences on west side of lower gate access road by water monitoring point GT-4.

There are several other items which need to be addressed:

- 1) The access road on the west side of the coal stockpile pad has a huge gully in it. This needs to be filled and compacted and a berm needs to be placed at the top to direct the runoff to the 6 inch CMP which is supposed to drain this area.
- 2) The remaining noncoal waste in the #2 Canyon supply yard should be disposed of. An agreement with a contractor and ECDC Environmental will need to be negotiated to do this.

Note: This inspection report does not constitute an affidavit of compliance with the regulatory program of the Division of Oil, Gas, and Mining.

Copy of this Report:

Mailed to: Ken Rushton (Trustee)


Mailed to: Marcia Petta (OSM)

Given to: Joe Helfrich (DOGM)

Filed to: Price Field Office

Date: June 6, 1996

Inspector's Signature: \_\_\_\_\_

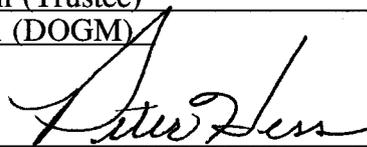

#46

Peter Hess