



24-88 0002
 STATE OF UTAH
 NATURAL RESOURCES
 Oil, Gas & Mining

File

John SCL

Norman H. Bangerter, Governor
 Dee C. Hansen, Executive Director
 Dianne R. Nielson, Ph.D., Division Director

355 W. North Temple • 3 Triad Center • Suite 350 • Salt Lake City, UT 84180-1203 • 801-538-5340

INSPECTION REPORT

INSPECTION DATE & TIME: 1-22-88
9:30-2:30

Permittee and/or Operators Name: Valley Camp of Utah
 Business Address: Scofield Route Helper, Utah
 Mine Name: Belina Complex Permit Number: ACT/007/001
 Type of Mining Activity: Underground Surface Other
 County: Carbon
 Company Official (s): Barry Barnum
 State Official(s): Holland Shepherd, Daron Haddock
 Partial: Complete: Date of Last Inspection: 12-7-87
 Weather Conditions: clear, cold, 2 ft of snow on ground.
 Acreage: Permitted 2837 Disturbed 79 Regraded 0 Seeded 0 Bonded 79
 Enforcement Action: none

COMPLIANCE WITH PERMITS AND PERFORMANCE STANDARDS

	YES	NO	N/A	COMMENTS
1. PERMITS	(X)	()	()	(X)
2. SIGNS AND MARKERS	(X)	()	()	()
3. TOPSOIL	(X)	()	()	()
4. HYDROLOGIC BALANCE:				
a. STREAM CHANNEL DIVERSIONS	(X)	()	()	()
b. DIVERSIONS	(X)	()	()	()
c. SEDIMENT PONDS AND IMPOUNDMENTS	(X)	()	()	(X)
d. OTHER SEDIMENT CONTROL MEASURES	(X)	()	()	(X)
e. SURFACE AND GROUNDWATER MONITORING	(X)	()	()	(X)
f. EFFLUENT LIMITATIONS	(X)	()	()	(X)
5. EXPLOSIVES	()	()	(X)	()
6. DISPOSAL OF DEVELOPMENT WASTE AND SPOIL	(X)	()	()	()
7. COAL PROCESSING WASTE	()	()	(X)	()
8. NONCOAL WASTE	(X)	()	()	()
21 PROTECTION OF FISH, WILDLIFE AND RELATED ENVIRONMENTAL VALUES	(X)	()	()	()
10. SLIDES AND OTHER DAMAGE	()	()	(X)	()
11. CONTEMPORANEOUS RECLAMATION	()	()	(X)	()
12. BACKFILLING AND GRADING	()	()	(X)	()
13. REVEGETATION	(X)	()	()	()
14. SUBSIDENCE CONTROL	(X)	()	()	(X)
15. CESSATION OF OPERATIONS	()	()	(X)	()
16. ROADS				
a. CONSTRUCTION	(X)	()	()	(X)
b. DRAINAGE CONTROLS	(X)	()	()	()
c. SURFACING	(X)	()	()	()
d. MAINTENANCE	(X)	()	()	()
17. OTHER TRANSPORTATION FACILITIES	(X)	()	()	()
18. SUPPORT FACILITIES				
UTILITY INSTALLATIONS	(X)	()	()	()

INSPECTION REPORT
(continuation sheet)

Page 2 of 3

PERMIT NUMBER: ACT/007/001

DATE OF INSPECTION 1-22-88

(Comments are Numbered to Correspond with Topics Listed Above)

1. Permits:

The operator received Mid-Term Permit approval on September 18, 1987; and was required to address six permit stipulations by Oct. 30, 1987. The operator has submitted the required information to the Division, meeting the deadline, and is presently waiting for the Division response.

4.c. Sediment Ponds:

1. The new sediment pond certifications will be complete by mid-March according to Mr. Barnum. Flyovers have been performed to obtain survey and topographic information relative to the Belina and Utah #2 Loadout site. Information obtained from these flyovers will be used to provide new, pond, certified, as-built designs. The flyovers were done by Olympus Aerial Surveyors, and prior to Jan. 1, 1988. When the certifications are complete, this will satisfy OSM, TDN 87-02-006-015, 7 of 8.

2. According to Mr. Steve Tanner of Valley Camp, admendments to the MRP addressing designs for ponds 2, 3, and 4, will be made also in mid-March. The admendments concern replacing present design plates, for these ponds, with ones which reflect current slopes and dimensions. Once completed, the admendments will satisfy OSM, TDN 87-002-006-015, 4 of 8.

3. Pond inspections at this site have been completed for all four quarters of 87.

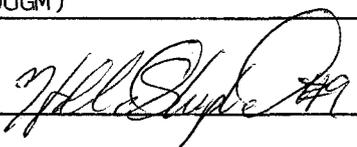
4.e. Water Monitoring:

Condition #1 or Permit Stipulation UMC 817.52-(1)-RS, will slightly change the operator's water monitoring plan. The new plan requires that the operator follow current DOGM water monitoring guidelines. The operator submitted the new water monitoring plan Oct. 30, 1987. The plan is still under review by the Division.

Copy of this Report:

Mailed to: Steve Tanner(Valley Camp), Brain Smith (OSM)

Given to: Joe Helfrich (DOGM)

Inspectors Signature and Number:  #9

Date: 2-3-88

INSPECTION REPORT
(continuation sheet)

Page 3 of 3

PERMIT NUMBER: ACT/007/001

DATE OF INSPECTION 1-22-88

(Comments are Numbered to Correspond with Topics Listed Above)

3. Water monitoring is current through 1987. No monitoring is required, yet, for 1988.

4.d. Other Sediment Controls:

The operator needs to ensure that culverts located at the Utah #2 site are functioning adequately. Heavy snows have recently fallen in the area and have covered much of the site under approximately 2 feet of snow. Snow removal from roads on the site may cause problems if wind rows and snow piles are left too long above culvert inlets and outlets.

4.f. Effluent Limitations:

Pond 005 (mine water pond), at the Belina site, was discharging at the time of inspection. Water samples were taken of the effluent. The water appeared clean. The analysis is not yet available.

14. Subsidence Control:

1. A subsidence survey was performed on Oct. 5, 1987 by the consulting firm of Hansen, Allen, and Luce Inc. The survey was performed on foot. The company is also contracting with the Forest Service to perform yearly, aerial surveys. However, the Forest Service has not been able to perform flyovers this year because of a problem with the location of some of their control monuments.

2. Milton Ohman, the only private landowner, associated with current mining, has been notified of the dates and extent of all underground mining activity to take place after Feb. 9, 1987. The operator provided a letter bearing the date date above, and addressed to Mr. Ohman.

16. Road Construction:

The new class I haul road certification will be completed by mid-March of 88. Completion of the certification has been tied into the aerial survey performed in December of 87, by Olympus Aerial Surveys. Completion of the certification will satisfy OSM, TDN 87-002-006-015, 8 of 8.

Inspectors Signature and Number:  Date: 2-3-88

INSPECTION REPORT
(continuation sheet)

Page 4 of 4

PERMIT NUMBER: ACT/041/002

DATE OF INSPECTION 1-27&28-88

(Comments are Numbered to Correspond with Topics Listed Above)

16. Road Construction:

The operator provided a certification for the class I haul road, which enters the site from Convulsion Canyon. The certification, dated 12-21-87, is a narrative statement addressing the criteria of 817.151-817.154. The operator still needs to provide or amend the plan with a certified as-built design for the haul road, addressing: slope, grade, location, drainage controls, etc. It was agreed that this material would be provided during the mid-term review.

Inspectors Signature and Number:

John L. [Signature]

Date:

2-4-88