



State of Utah
DEPARTMENT OF NATURAL RESOURCES
DIVISION OF OIL, GAS AND MINING

gh

Michael O. Leavitt
Governor
Ted Stewart
Executive Director
James W. Carter
Division Director

355 West North Temple
3 Triad Center, Suite 350
Salt Lake City, Utah 84180-1203
801-538-5340
801-359-3940 (Fax)
801-538-5319 (TDD)

INSPECTION REPORT

Partial: X Complete: Exploration:
Inspection Date & Time: 1/27/94: 2:00 pm to 4:00 pm:
Date of Last Inspection: December 8, 1993

Mine Name: Sunnyside Coal Mine County: Carbon Permit Number: ACT/007/007
Permittee and/or Operator's Name: Sunnyside Coal Company (SCC)
Business Address: PO Box 99, Sunnyside, Utah 84539
Type of Mining Activity: Underground X Surface Prep. Plant Other
State Officials(s): Henry Sauer, Company Official(s): Peter Hess Federal Official(s): None
Weather Conditions: Clear and Cold
Existing Acreage: Permitted-14475 Disturbed-310 Regraded-0 Seeded-0 Bonded-310
Increased/Decreased: Permitted- Disturbed- Regraded- Seeded- Bonded-
Status: Exploration/ X Active/ Inactive/ Temporary Cessation/ Bond Forfeiture
Reclamation (Phase I/ Phase II/ Final Bond Release/ Liability Year)

REVIEW OF PERMIT, PERFORMANCE STANDARDS & PERMIT CONDITION REQUIREMENTS

Instructions

- 1. Substantiate the elements on this inspection by checking the appropriate performance standard.
a. For complete inspections provide narrative justification for any elements not fully inspected unless element is not appropriate to the site, in which case check N/A.
b. For partial inspections check only the elements evaluated.
2. Document any noncompliance situation by referencing the NOV issued at the appropriate performance standard listed below.
3. Reference any narratives written in conjunction with this inspection at the appropriate performance standard listed below.
4. Provide a brief status report for all pending enforcement actions, permit conditions, Division Orders, and amendments.

Table with 5 columns: Item, EVALUATED, N/A, COMMENTS, NOV/ENF. Rows include: 1. PERMITS, CHANGE, TRANSFER, RENEWAL, SALE; 2. SIGNS AND MARKERS; 3. TOPSOIL; 4. HYDROLOGIC BALANCE; 5. EXPLOSIVES; 6. DISPOSAL OF EXCESS SPOIL/FILLS/BENCHES; 7. COAL MINE WASTE/REFUSE PILES/IMPOUNDMENTS; 8. NONCOAL WASTE; 9. PROTECTION OF FISH, WILDLIFE AND RELATED ENVIRONMENTAL VALUES; 10. SLIDES AND OTHER DAMAGE; 11. CONTEMPORANEOUS RECLAMATION; 12. BACKFILLING AND GRADING; 13. REVEGETATION; 14. SUBSIDENCE CONTROL; 15. CESSATION OF OPERATIONS; 16. ROADS; 17. OTHER TRANSPORTATION FACILITIES; 18. SUPPORT FACILITIES/UTILITY INSTALLATIONS; 19. AVS CHECK (4th Quarter-April, May, June) (date); 20. AIR QUALITY PERMIT; 21. BONDING & INSURANCE.



## INSPECTION REPORT

(Continuation sheet)

Page 2 of 2

PERMIT NUMBER: ACT/007/007

DATE OF INSPECTION: 1/27/94

(Comments are Numbered to Correspond with Topics Listed Above)

4. HYDROLOGIC BALANCE:  
a. DIVERSIONS

The lower gate access road berm must be augmented.

The berm at around the empty 55-gallon drum storage area in the No. Two Canyon must be augmented.

e. EFFLUENT LIMITATIONS

A new decant system for UPDES Outfall # 015 was discussed during the December 1993 inspection. An official proposal from the operator has not been submitted to date. The operator was instructed to seek approval of the new system as soon as possible.

6. DISPOSAL OF EXCESS SPOIL/FILLS/BENCHES

Small coal piles (less than 1 cubic yard per pile) were observed immediately north of the train loadout. The operator was instructed to remove these piles and place the coal in a designated location.

7. COAL MINE WASTE/REFUSE PILES/IMPOUNDMENTS GENERAL COMMENTS:

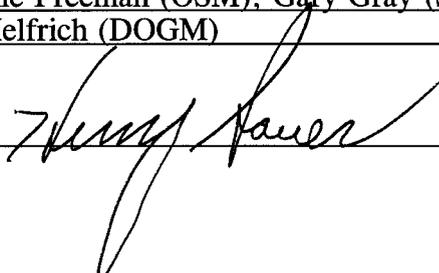
A portion of the East Slurry Cell (ESC) has been cleaned of dried slurry. At the time of the inspection the ESC was not active. However, it has been active during the previous two weeks. Mr. Gary Gray informed me that prior to its most current use the ESC had not been used since September 16, 1993.

The refuse piles within the Sacco Flats Temporary Refuse Storage Area have been removed. Signs have been placed around the storage area to prevent machinery operators from dumping loads beyond the signs and into the diversion ditches.

Copy of this Report:

Mailed to: Bernie Freeman (OSM), Gary Gray (SCC)

Given to: Joe Helfrich (DOGM)

Inspector's Signature:  #32 Date: 2/4/94