



STATE OF UTAH
NATURAL RESOURCES
Oil, Gas & Mining

Scott M. Matheson, Governor
Temple A. Reynolds, Executive Director
Dianne R. Nielson, Ph.D., Division Director

4241 State Office Building • Salt Lake City, UT 84114 • 801-533-5771

August 2, 1984

CERTIFIED RETURN RECEIPT REQUESTED
(492 430 091)

Ms. Barbara Filas
U. S. Steel Mining Company, Inc.
P. O. Box 437
Wellington, Utah 84542

Dear Ms. Filas:

RE: Review Based on Plans Submitted July 21, 1984 and a Site Visit July 18, 1984 Regarding NOV/N84-2-13-1, Wellington Preparation Plant, ACT/007/012, #3 and #7, Carbon County, Utah

On July 18, 1984, Barbara Filas, representing U. S. Steel, Sandy Pruitt and Tom Munson, representing the Division of Oil, Gas and Mining (DOG M), visited the modified slurry line catch basin pertaining to violation NOV N84-2-13-1. The structure was built after the original approved plans for three gabion structures failed and a new plan was necessitated.

The operator implemented an alternate design to replace the three gabion structures and then submitted as-built plans regarding this new structure to the Division on July 2, 1984. On July 18, 1984, an on-site inspection of this structure pointed out some inconsistencies between the plans submitted and the actual on-site construction.

Extensive ditch work is associated with the routing of water into this structure and these ditches were also examined to ascertain their stability and function. Due to the erosive nature of the soil, the operator was asked to implement energy dissipation at critical portions of the ditches. The company was also directed to install riprap to prevent massive erosion from occurring.

After observing the as-built structures, it is the Division's opinion that the plans submitted (July 2, 1984) do not accurately depict what has been constructed on-site. The operator must submit an accurate figure showing the dimensions of the earthen catch basin and its associated dam with gabion spillway. This figure must also depict the inslope and outslope angles of this structure. In addition, the operator must address how they will stabilize the


Page Two
Ms. Barbara Filas
August 2, 1984

ditches in the area preferably by methods other than the use of loose tires. It is the Division's opinion that this method may not prove adequate based on the means by which the tires were placed in the ditch. The operator must attempt to stabilize the ditches in a fashion which will prevent excessive erosion. Using riprap to anchor the loose tires has been suggested by the operator. The Division will base its acceptance of this method upon an on-site inspection to be conducted within 15 days of installation. Please notify the Division when the stabilization work is complete.

The Division requires the submission of more accurate drawings of the catch basin and dam, as well as a written commitment (and plan) to improve the stability of the ditches based on ideas similar to those brought forth in this letter. The operator has seven days to provide an adequate response to this letter based upon the date of receipt.

Should any questions arise, feel free to contact me or Tom Munson of the Division staff.

Sincerely,

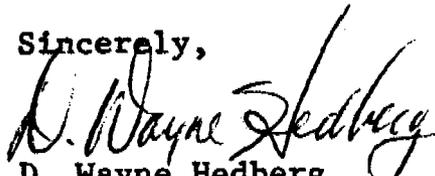

D. Wayne Hedberg
Permit Supervisor/
Reclamation Hydrologist

DWH/TM:btb

cc: Allen Klein, OSM, Denver
Robert Hagen, OSM, Albuquerque
Jim Smith, DOGM
Joe Helfrich, DOGM
Sandy Pruitt, DOGM
Tom Munson, DOGM

88600-15 & 16

PS Form 3811, Dec. 1989

● **SENDER:** Complete items 1, 2, 3, and 4. Add your address in the "RETURN TO" space on reverse.

(CONSULT POSTMASTER FOR FEES)

- 1. The following service is requested (check one).
 - Show to whom and date delivered — 0
 - Show to whom, date, and address of delivery.. — 0
- 2. **RESTRICTED DELIVERY** — 0
(The restricted delivery fee is charged in addition to the return receipt fee.)

TOTAL \$

3. **ARTICLE ADDRESSED TO:**
BARBARA FLAS - US Steel
PO Box 437
Wellington UT 84154

4. **TYPE OF SERVICE:** **ARTICLE NUMBER**


REGISTERED INSURED 492

CERTIFIED COD 430 091

EXPRESS MAIL

(Always obtain signature of addressee or agent)

I have received the article described above.
SIGNATURE Addressee Authorized agent

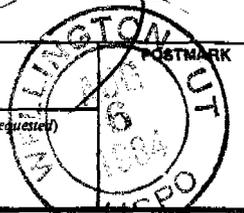DATE OF DELIVERY 

6. **ADDRESSEE'S ADDRESS** (Only if requested)

7. **UNABLE TO DELIVER BECAUSE:** **EMPLOYEE'S INITIALS**
OK

RETURN RECEIPT, REGISTERED, INSURED AND CERTIFIED MAIL

UNITED STATES POSTAL SERVICE
OFFICIAL BUSINESS

SENDER INSTRUCTIONS

Print your name, address, and ZIP Code in the space below.

- Complete items 1, 2, 3, and 4 on the reverse.
- Attach to front or attach to space permit.
- Obvise article to back of article.
- Endorse article "Return Receipt Requested" adjacent to number.

RETURN TO



PENALTY FOR PRIVATE USE TO AVOID PAYMENT OF POSTAGE \$300

State of Utah
Rational Resources & Energy
Oil, Gas, & Mining
4211 State Office Building
Salt Lake City, Utah 84114

(Name of Sender)

(Street or P.O. Box)

(City, State, and ZIP Code)

