

0002



SCOTT M. MATHESON
Governor

OIL, GAS, AND MINING BOARD

GORDON E. HARMSTON
Executive Director,
NATURAL RESOURCES

STATE OF UTAH

DEPARTMENT OF NATURAL RESOURCES

DIVISION OF OIL, GAS, AND MINING

1588 West North Temple
Salt Lake City, Utah 84116
(801) 533-5771

CHARLES R. HENDERSON
Chairman

CLEON B. FEIGHT
Director

JOHN L. BELL
C. RAY JUVELIN
THADIS W. BOX
CONSTANCE K. LUNDBERG
EDWARD T. BECK
E. STEELE McINTYRE

September 10, 1979

Blazon Company
Mr. Joseph Harvey, President
P.O. Box 327
Ferron, Utah 84523

Dear Mr. Harvey:

Enclosed is a copy of the comments received by the Division from the Division of Water Rights in regards to the Drainage Study and Additional Information Submittal for the Blazon #1 Mine. The Division awaits your reply.

Sincerely,

THOMAS J. SUCHOSKI
RECLAMATION HYDROLOGIST

TJS/sp
enc.



STATE OF UTAH
DEPARTMENT OF NATURAL RESOURCES
DIVISION OF WATER RIGHTS

DEE C. HANSEN
STATE ENGINEER

EARL M. STAKER
DEPUTY

200 EMPIRE BUILDING
231 EAST 400 SOUTH
SALT LAKE CITY, UTAH 84111
(801) 533-6071

DIRECTING ENGINEERS
HAROLD D. DONALDSON
DONALD C. NORSETH
STANLEY GREEN
ROBERT L. MORGAN

September 6, 1979

Mr. Thomas J. Suchoski
Reclamation Hydrologist
Division of Oil, Gas, and Mining
1588 West North Temple
Salt Lake City, Utah 84116

Dear Mr. Suchoski:

Re: Blazon No. 1 Mine

This office has completed its review of the Drainage Study and the Additional Information Submittal for the above mentioned mine. I am not concerned with the sedimentation ponds, as in my opinion they do not pose a threat to life or property, but the Detention Pond does concern me.

Because of the size of the pond (15 acre-feet, 20 foot embankment) and its location, it is my opinion that a failure would pose a threat to life and property at the mine site and downstream at the town of Clear Creek, Utah. I would therefore request that before construction be allowed that the final project be reviewed by this office, and that the final construction drawings be approved by me.


The following comments are directed to the embankment design and the materials used for construction:

1. I would request the flood routing for the 1,000 year 24 hour event.
2. The construction drawings do not show details of:
 - a. 42-inch outlet's bedding or cradle preparation.
 - b. screen details for the outlet or its hydraulic considerations.
 - c. cutoff collars along the outlet.
3. The riprap thickness.
4. The zones in the dam are reversed from normal practice.
5. The compaction effort is 95% by what method.
6. No material data was supplied for the soil, riprap, or foundation.

7. Will construction specifications be prepared.
8. Was a cutoff or keyway considered to tie the embankment into the foundation.
9. What will be the foundation treatment.

I realize that you are not prepared to answer the above mentioned concerns, but if you would kindly inform us as to whether we should contact the owner or if you will have them supply the information. Please keep Bob Morgan, of my staff, informed on the project.

Sincerely,

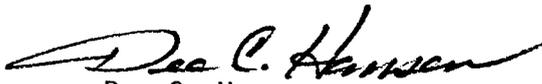

Dee C. Hansen
Utah State Engineer

DCH:RLM:sn