

#3834
R

WATER QUALITY MEMORANDUM

Utah Coal Regulatory Program

January 9, 2012

TO: Internal File

THRU: Steve Christensen, Permit Supervisor *SC*

FROM: Ken Hoffman, Hydrologist *KH*

RE: 2011 Second Quarter Water Monitoring, Genwal Resources, Inc., Crandall Canyon Mine, C/015/0032, Task ID #3834

Water monitoring requirements for the Crandall Canyon Mine can be found in Sections 7.31.21, *Ground Water Monitoring Plan* and 7.31.22, *Surface Water Monitoring Plan*. Additional information can be found in Tables 7-4, 7-5, 7-8, 7-9 and 7-10.

Water encountered during mining operations was pumped to the portals and discharged to Crandall Creek under UPDES Permit No. UTU0024368. Discharges to Crandall Creek were within the limitations established by the permit with rare exceptions. Prior to 2008 only one sample reported an iron concentration greater than 1 mg/L (July 26, 2004 -1.08 mg/L). UPDES Permit No. UTU002438 was renewed on May 1, 2011 with a total iron maximum daily effluent limitation of 1.24 mg/L.

Following the mine collapse in August 2007, the pumps were removed from the mine and discharge ceased temporarily. From September 2007 through December 2007 water pooled within the mine, flooding the underground workings. In January 2008 the mine began discharging by gravity flow and has been discharging continuously since. The temporary seals placed in the portals following the collapse required modification to control the mine water discharge. Iron concentrations in the mine water discharge occasionally exceeded 1 mg/L from January to November 2008; and have been greater than 1 mg/L continuously since December 2008. Construction of a mine water treatment system began in December 2009 and was approved by the Division in January of 2010.

Since April of 2010, the mine water treatment system has proven effective in reducing total iron concentrations to within the 1.24 mg/L UPDES limit. Additionally, the Permittee began sampling the pre-treatment raw mine water (Pre 002) in April of 2010. The sampling of the raw mine water is conducted in an effort to monitor changes in mine water chemistry that might indicate what (if any) changes are occurring to the iron concentrations. To date, the total iron concentrations in the raw mine-water remain above 1.24 mg/L.

1. Was data submitted for all of the MRP required sites? YES NO

Springs

The approved MRP requires the monitoring of 24 springs each quarter. Of these 24 springs, 9 require laboratory water quality analysis (See Table 7-4). The remaining 15 springs require quarterly monitoring of field parameters (flow, pH, specific conductance and temperature).

As a result of the snow and ice conditions at the mine and adjacent area, only Little Bear, Sp-18, SP-22, SP-30, SP-36, and SP-58 spring monitoring sites could be accessed this quarter.

Streams

The approved MRP requires the monitoring of 12 surface water/stream sites. Of these 12 surface water/stream sites, 9 require laboratory water quality analysis (See Table 7-8). The remaining 3 sites require quarterly monitoring of field parameters (flow, pH, specific conductance, temperature and dissolved oxygen).

Due to the limited access as a result of the snow, Indian Creek, Little Bear Creek, and Section 4 Creek monitoring sites could not be accessed.

Wells

The approved MRP outlines monitoring of 7 wells. According to Table 7-4, all 7 wells required quarterly laboratory water quality analysis. However, due to the mine disaster on August 6th, 2007, the active mine-workings have been sealed thus rendering the wells inaccessible.

UPDES

The UPDES Permit/MRP (UT000024368) requires monthly monitoring of 2 outfalls: 001 and 002. Outfall 001 is associated with the discharge from the primary sediment pond at the main mine facility. Outfall 002 is associated with the mine-water discharge that reports directly to Crandall Creek.

The required data was submitted for Outfalls 001 and 002.

Pre-Treatment Mine Water Discharge

As part of the permitting process for the mine-water treatment system (Task ID #3461, approved January 27th, 2010), the Permittee has committed to monthly sampling of the pre-

treatment mine water discharge for the following parameters:

- *Iron (total, dissolved and ferrous)*
- *Manganese (total and dissolved)*
- *Aluminum (total and dissolved)*
- *Alkalinity*
- *Sulfate*
- *pH*
- *Dissolved Oxygen*

The required Monthly data was collected for the pre-treatment mine water discharge and submitted to the EDI.

2. Were all required parameters reported for each site? YES NO

Springs

All required parameters were reported for the surface water monitoring sites that were accessible and produced a measurable flow.

Streams

All required parameters were reported for the surface water monitoring sites that were accessible and produced a measurable flow.

Wells

Since the mine collapse in August of 2007, the monitoring wells are inaccessible.

UPDES

Outfall 001 was sampled during June when discharge was present and 002 was sampled each month of the quarter as required by the UPDES permit. All required parameters were reported for Outfall 001 and 002.

As part of the approval for the mine-water treatment system (Task ID #3461), the Permittee committed to obtain additional monthly samples for Outfall 002. The parameters include (D-Fe, FE2+, T-Mn, D-Mn, T-Al, D-Al, Alkalinity and Sulfate). Concentrations were reported for each of the additional parameters at Outfall 002.

Pre-Treatment Mine Water Discharge

As discussed above, monthly sampling of the Pre-Treatment Mine Water Discharge became a requirement with the approval of the mine-water discharge treatment system.

The required pre-treatment mine discharge parameters were reported this quarter as required.

3. Were any irregularities found in the data? YES NO

Springs

The following springs had the listed parameters listed below more than two standard deviations from the mean:

Little Bear Spring: total cations, total anions, total hardness - June
SP-58: dissolved magnesium, total hardness, total dissolved solids, sulfate - June

Streams

The following streams had flow measurements during June more than two standard deviations from the mean: Blind Canyon Flume, Horse Canyon, Crandall Canyon Lower Flume, Section 5 Creek, Shingle Creek, Crandall Canyon Upper Flume, and Upper Left Fork Section 5 Creek. In addition, the listed parameters were more than two standard deviations from the mean.

Blind Canyon Flume: dissolve magnesium - June
Horse Canyon: cation-anion balance - June
Crandall Canyon Lower Flume: cation-anion balance – June

As the total iron (T-Fe) concentrations in the mine-water discharge began to increase, a concern was that a similar rise would be observed in stream monitoring site Lower Crandall Canyon Flume (LOF-1). An upward trend of T-Fe began to surface the second quarter of 2008 in correspondence with the increase in iron concentrations of the mine-water discharge. A T-Fe concentration of 1.479 gpm was reported the fourth quarter of 2009. Once the mine-water treatment system became operational during the 1st quarter of 2010, the iron concentrations detected at LOF-1 have dropped significantly. The T-Fe concentration for LOF-1 this quarter was 0.37 mg/L.


UPDES Sites (001 and 002)

Outfall 001 reported discharge and sampling results for April 15, 2011, however after discussion with Division of Water Quality a letter from the mine has been placed on file that no discharge occurred from Outfall 001 during April 2011 and the sample has been removed from the DOGM database. At Outfall 001 on June 15, 2011 the total suspended solids concentration was measured at 39 mg/L. This exceeds the 7-day average effluent limitation and 30 day average effluent limitation.

Based upon three sampling events, outfall 002 reported an average flow value of 511 gpm. The T-Fe concentrations of the water discharging from the mine-water treatment basin were well within the 1.24 mg/L standard established by the UPDES permit The mine-water treatment system continues to be effective in reducing the T-Fe concentrations to within the UPDES discharge permit limit of 1.24 mg/L.

Pre-Treatment Mine Water Discharge

The T-Fe concentrations in the pre-treatment mine water remain well above the 1.24 mg/L UPDES limit. Based on three sampling events the resulting concentrations for T-Fe were 2.55, 2.13, and 2.27 for April, May, and June respectively. The T-Fe data shows that concentration is variable and has not produced a significant downward trend but instead a leveling out of the concentration. In addition, total alkalinity, bicarbonate as CaCO₃, and dissolved calcium were found to be more than two standard deviations from the mean during June.

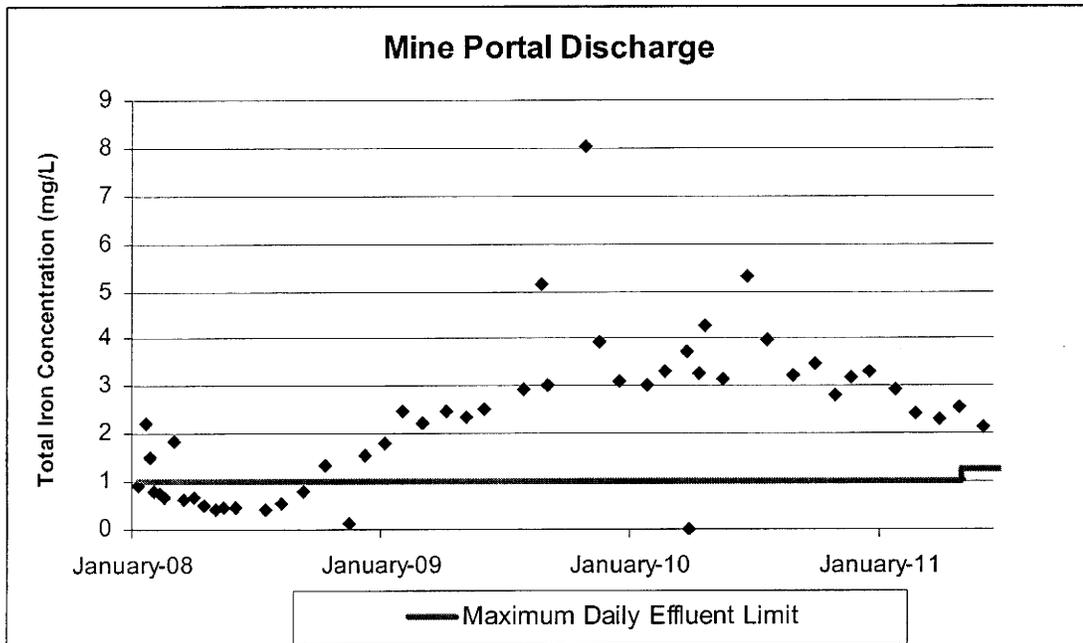

4. On what date does the MRP require a five-year re-sampling of baseline water data.

Page 7-33 of the MRP states that groundwater samples collected during the low flow period (typically the 4th quarter) every 5 years will be analyzed for baseline parameters (See Tables 7-5). Baseline sampling was conducted this quarter. All required baseline parameters were reported for all ground and surface water monitoring points.

Page 7-35 of the MRP states that surface water samples collected during the low flow period every 5 years will be analyzed for baseline parameters (See Table 7-9). The 4th quarter of 2015 will be the next sampling event where baseline data will be required.

5. Based on your review, what further actions, if any, do you recommend?

Continued data collection and monitoring of the mine-water discharge will be necessary to evaluate the effectiveness of the mine-water treatment system. Monitoring of the pre-treatment mine-water will help determine the overall chemistry of the raw mine-water and help determine if the T-Fe concentrations are showing any change in concentration.