

0011



FAX TRANSMITTAL



FOREST SUPERVISOR'S OFFICE  
and PRICE RANGER DISTRICT  
599 WEST PRICE RIVER DRIVE  
PRICE UT 84501

PHONE: (435) 637-2817  
FAX: (435) 637-4940

*incoming*  
*Daron (already copied)*

*ACT/007/001*

*Copy Mike,*  
*FAX PRO*

TO: Pam Grubaugh-Littig

FAX #: 801-359-3940

FROM: Carter Reed

SUBJECT: White Oak 160 acre IBC

TOTAL PAGES INCLUDING COVER PAGE: 3

COMMENTS:

Here it is as requested. You should have received the mail copy by now.

*CR*



United States  
Department of  
Agriculture

Forest  
Service

Manti-La Sal  
National Forest

Supervisor's Office  
599 West Price River Drive  
Price, UT 84501  
Phone # (435) 637-2817  
Fax # (435) 637-4940

File Code: 2820-4

Date: March 16, 2000

Mary Ann Wright  
Utah Department of Natural Resources  
Division of Oil, Gas and Mining  
1594 West North Temple, Suite 1210  
P.O. Box 145801  
Salt Lake City, Utah 84114-5801

RE: 160 Acre Incidental Boundary Change, Lodestar Energy Co. White Oak Mine,  
ACT/00/007/001-IBC99F

Dear Mary Ann:

The Forest Service hereby consents/concurs to approval of the IBC by the Division subject to the following Mining and Reclamation Plan revisions to be completed at the earliest possible date:

1. Page 0-6 of 14. In the event that water is lost in either Coal or Cox Canyons, Lodestar must commit to water replacement by a method acceptable to the Forest Service (surface management agency).
2. Page 300-3. Since both Coal and Cox Canyon Creeks are perennial, Lodestar must provide specific information on Coal and Cox Canyons regarding fish and other aquatic species.
3. Page 500-10, Paragraph 6. The statement regarding restoration of surface lands must be changed from "technologically and economically feasible" to "technologically feasible". Add a sentence that restoration plans are subject to approval of the regulatory agency and surface management agency.
4. Page 500-20, Paragraph 4, Second Bullet. Revise the first sentence to indicate that monitoring would be required to continue for a longer time if subsidence cannot be demonstrated to be substantially complete.
5. Page 700-10. The monitoring plan must include mapping of the flowing and non-flowing portions of Coal and Cox Canyons each fall around October 1 to determine if there have been any impacts to perennial stream reaches. This information needs to be compared to precipitation data. Our data shows that Cox Canyon Creek is perennial but Coal Canyon Creek may not be. Additional monitoring will be necessary to properly characterize flow.
6. Riparian vegetation must be mapped on Plate 3-1 and described in the wildlife habitat and vegetation sections. The riparian vegetation communities should be characterized by the dominant overstory and understory species. Since Cox Canyon Creek is



White Oak Mine 160-acre IBC


2

characterized as perennial, it can be reasonably expected that they contain riparian vegetation and habitat. Additional mapping of Coal Canyon needs to be done to determine if it contains riparian vegetation.

7. Overburden Map 5-3A is incomplete in the IBC area and must be completed to determine if there are areas with less than 200 feet of cover that must not be mined.
8. The four subsidence monitoring points are located along the northern boundary of the IBC and do not adequately present information on the four panels. Add a subsidence monitoring point in the bottom of the two upper tributaries of Coal Canyon near the southern portion of the IBC. This would provide information on the most sensitive areas in the IBC with shallow overburden.

If you have any questions, contact Carter Reed or Jeff DeFrest at the Forest Supervisor's Office in Price, Utah.

Sincerely,

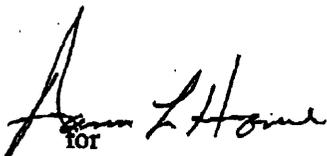

for  
JEFF WALTER  
Acting Forest Supervisor

cc:

D-2/3 (Jeff DeFrest)  
Dick Manus, BLM Price Field Office

TRANSACTION REPORT

P. 01

MAR-22-2000 WED 01:14 PM

FOR: OIL, GAS & MINING

801 359 3940

DATE START	RECEIVER	TX TIME	PAGES	TYPE	NOTE	M#	DP
MAR-22 01:13 PM	14356135828	58"	3	SEND	OK	103	

TOTAL : 58S PAGES: 3

10:04 FAX 101022214356374940

MANTI-LA SAL NF

001/003



FAX TRANSMITTAL



FOREST SUPERVISOR'S OFFICE  
and PRICE RANGER DISTRICT  
599 WEST PRICE RIVER DRIVE  
PRICE UT 84501

*Freemling*  
*Daran (already copied)*  
*ACT/087/001*

010018 1435 637 2917