



**COPY**

**Date:** August 11, 2004  
**To:** Vicky Miller  
**From:** David G. Spillman  
**Subject:** Subsidence Considerations – SITLA Lease

*Incoming &  
 C/087/0039  
 Copy Wayne W.*

As requested, the following is a brief description regarding potential subsidence associated with our current "barrier case" mine layout.

Longwall mining commenced at the Dugout Canyon Mine in April 2001. At that point in time, the Rock Canyon seam layout consisted of four longwall panels. These panels were aligned immediately adjacent to each other, without load supporting barrier pillars. This plan was implemented in an attempt to maximize resource recovery. However, this layout was considered aggressive, due to the potential of unfavorable caving conditions of the overlying geologic strata. This strata or overburden included three significant sandstone members; the Castlegate SS, Upper Sunnyside SS and Lower Sunnyside SS. These three SS members were believed to be somewhat subsidence resistant and had potential to form a "lagging cave" condition.

Subsequently, lagging cave conditions were confirmed during the mining of the second, third and fourth Rock Canyon longwall panels. In fact, significant portions of the second and third panels were abandoned due to unsafe mining conditions.

Based on our actual mining experience, as well as, extensive geotechnical analysis, it was determined that load supporting barriers would be necessary for future longwall panels. These barriers will essentially isolate individual panel extraction areas, while providing long-term support for the subsidence resistant SS members. This mine plan design will not allow for fracturing and caving to propagate to the surface, thus minimizing the potential for subsidence.

RECEIVED

NOV 29 2004

DIV. OF OIL, GAS & MINING

File in:


Confidential

Shelf

Expandable

Refer to Record No. 0078 Date 08/11/2004

In C/0070039 2004 Incoming

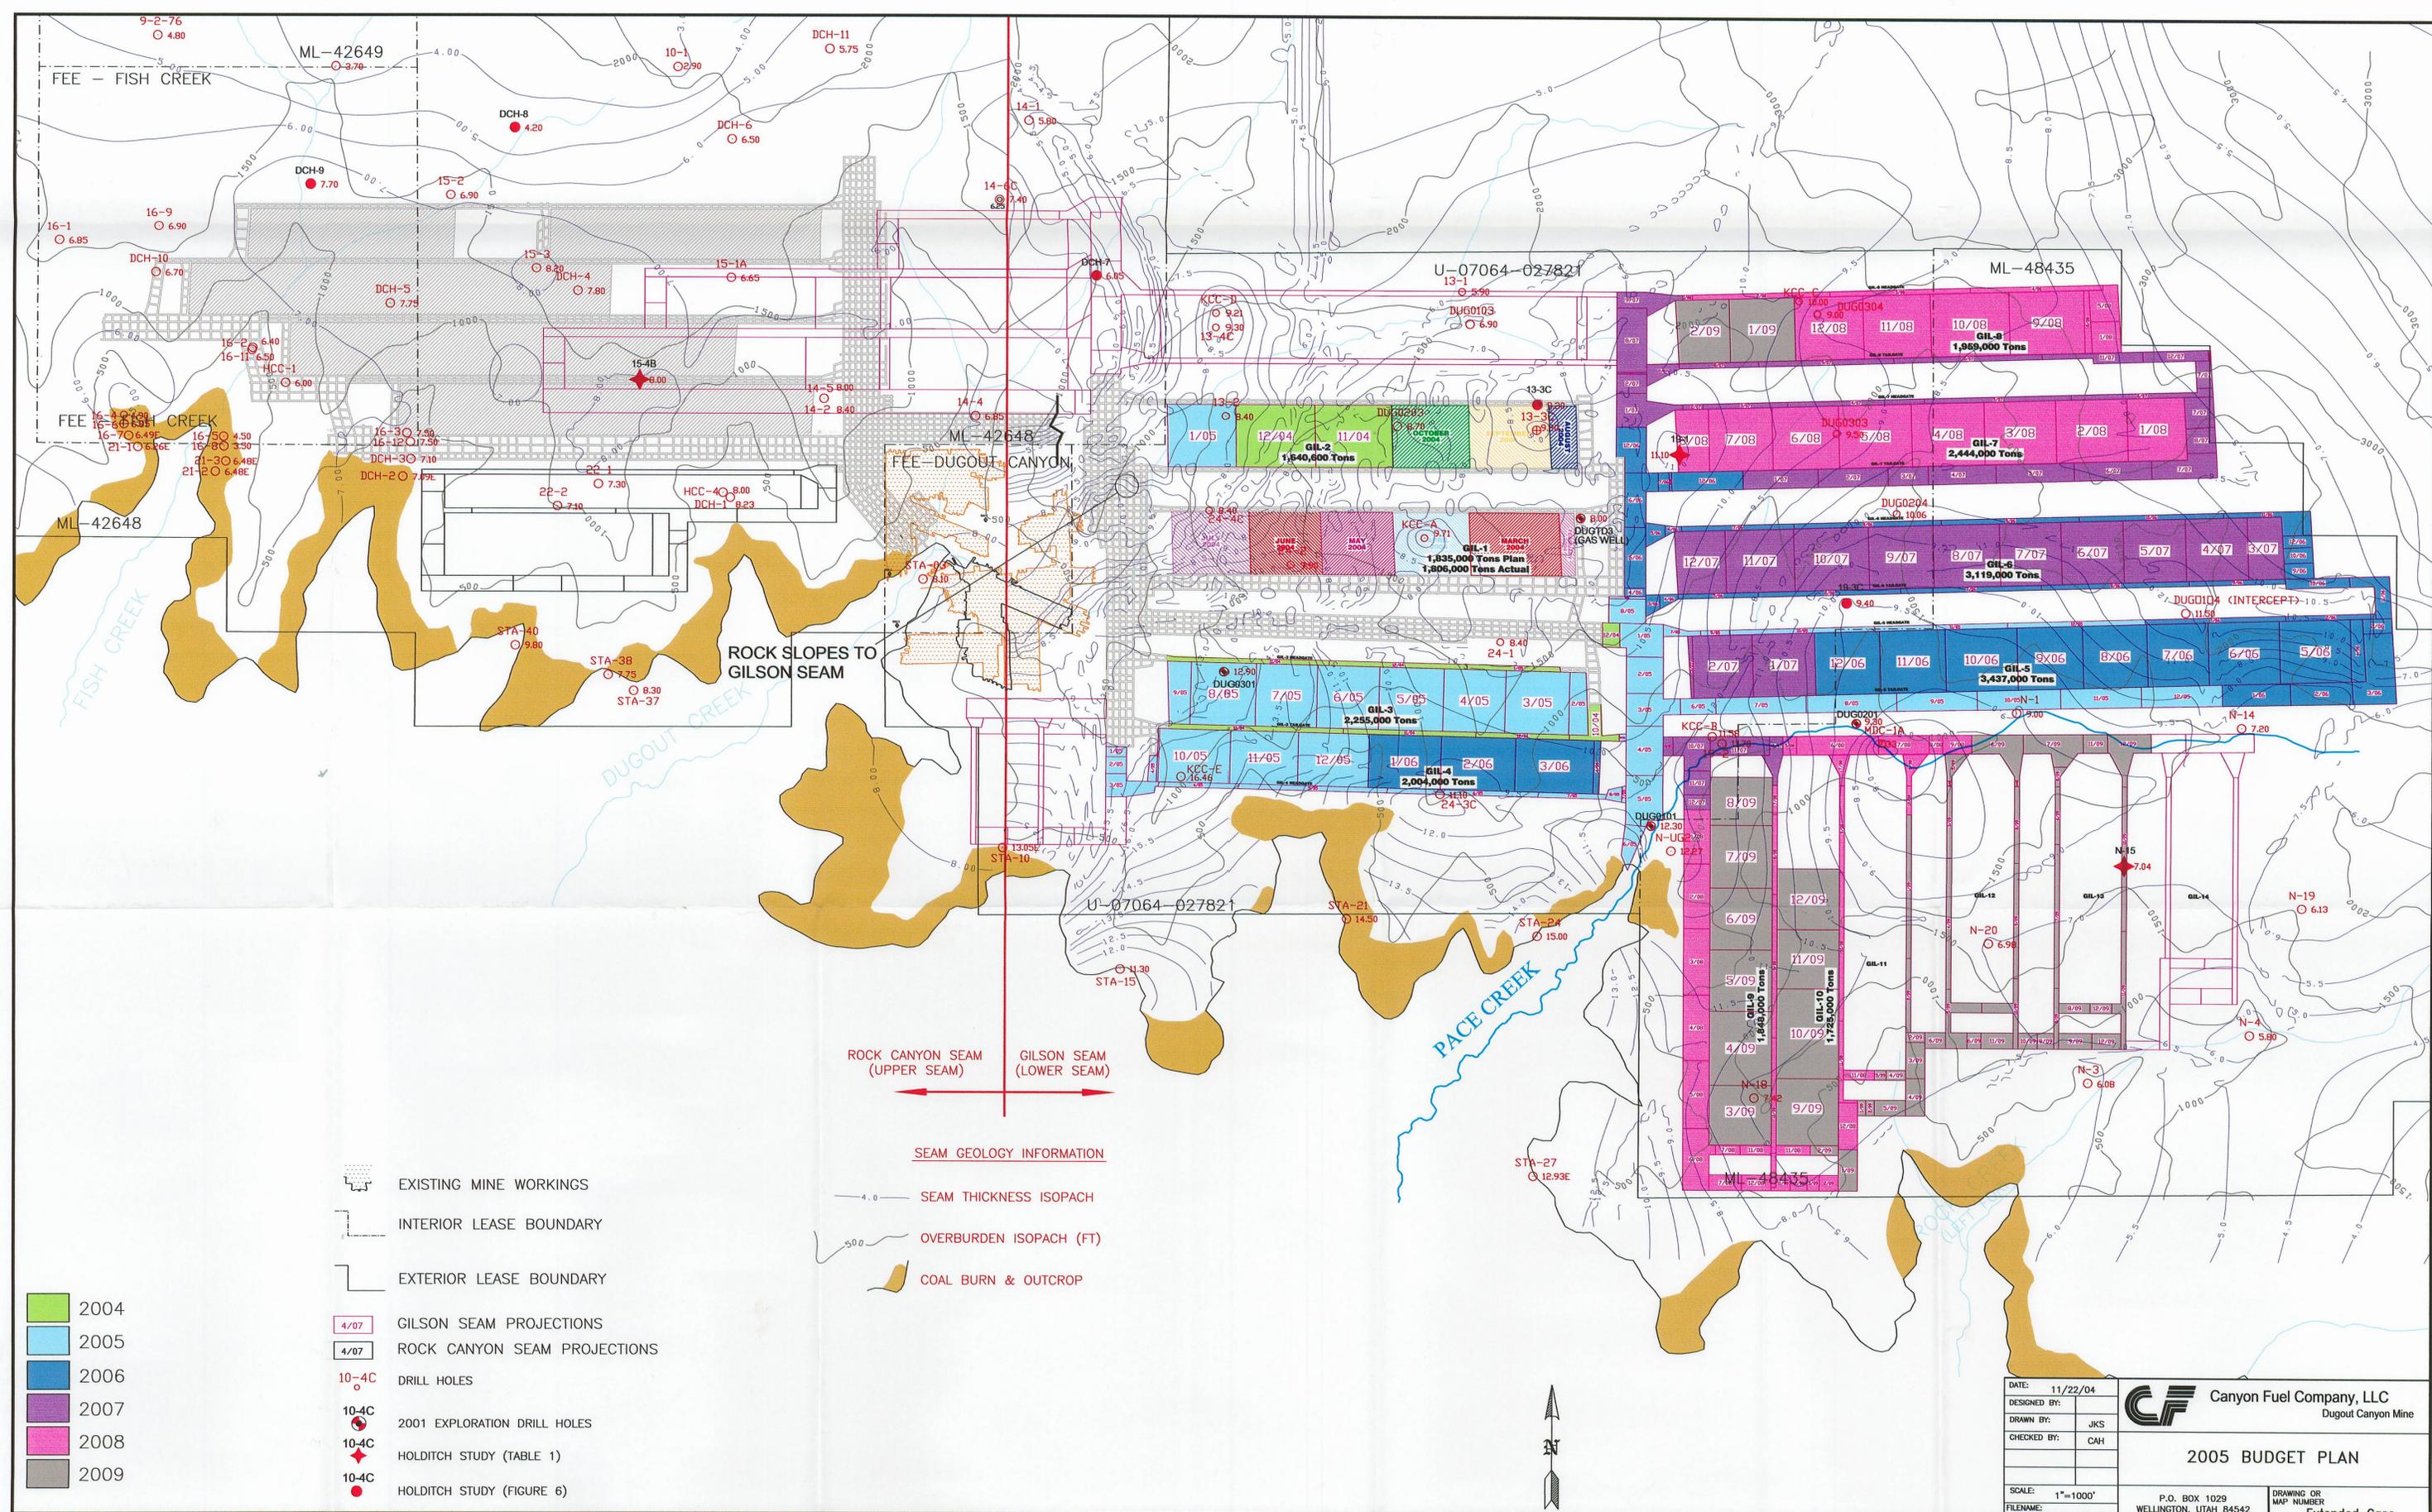

- 2004
- 2005
- 2006
- 2007
- 2008
- 2009
- 4/07 GILSON SEAM PROJECTIONS
- 4/07 ROCK CANYON SEAM PROJECTIONS
- 10-4C DRILL HOLES
- 10-4C 2001 EXPLORATION DRILL HOLES
- 10-4C HOLDITCH STUDY (TABLE 1)
- 10-4C HOLDITCH STUDY (FIGURE 6)

**SEAM GEOLOGY INFORMATION**  
 4.0 SEAM THICKNESS ISOPACH  
 5.0 OVERBURDEN ISOPACH (FT)  
 COAL BURN & OUTCROP

DATE: 11/22/04		Canyon Fuel Company, LLC Dugout Canyon Mine
DESIGNED BY:	JKS	
DRAWN BY:	CAH	<b>2005 BUDGET PLAN</b>
CHECKED BY:	CAH	
SCALE: 1"=1000'	P.O. BOX 1029	DRAWING OR MAP NUMBER
FILENAME: \\canyonfuel\shared\2005\Budget\2005 Budget.dwg	WELLINGTON, UTAH 84542	Extended Case