



# State of Utah

DEPARTMENT OF NATURAL RESOURCES

MICHAEL R. STYLER  
Executive Director

Division of Oil, Gas and Mining

JOHN R. BAZA  
Division Director

## Inspection Report

Permit Number:	C0070038
Inspection Type:	COMPLETE
Inspection Date:	Wednesday, September 28, 2016
Start Date/Time:	9/28/2016 1:00:00 PM
End Date/Time:	9/28/2016 2:30:00 PM
Last Inspection:	

Representatives Present During the Inspection:
OGM Keenan Storrar

Inspector: Keenan Storrar

Weather: Sunny

InspectionID Report Number: 5655

Accepted by: DHADDOCK  
10/14/2016

Permitee: **PLATEAU MINING, LLC**  
 Operator: **PLATEAU MINING, LLC**  
 Site: **WILLOW CREEK MINE**  
 Address: **PO BOX 30, HELPER UT 84526-0030**  
 County: **CARBON**  
 Permit Type: **PERMANENT COAL PROGRAM**  
 Permit Status: **INACTIVE**

### Current Acreages

1.19	<b>Total Permitted</b>
1.19	<b>Total Disturbed</b>
187.85	<b>Phase I</b>
187.85	<b>Phase II</b>
186.66	<b>Phase III</b>

### Mineral Ownership

- Federal
- State
- County
- Fee
- Other

### Types of Operations

- Underground
- Surface
- Loadout
- Processing
- Reprocessing

### Report summary and status for pending enforcement actions, permit conditions, Division Orders, and amendments:


The Division of Oil, Gas and Mining conducted an inspection at the Willow Creek mine on September 28, 2016. The road leading up to the shaft had been severely damaged by a rainstorm within the last few weeks. The road had been gullied up to a foot deep in many areas and was littered with large rocks and debris. Further up canyon, about a hundred yards down the road from the shaft, a debris flow washed onto the road preventing travel by vehicle. The flow deposited as much as three to four feet of sediment and carried boulders as large as 7 feet diameter that came to rest in the center of the road. The condition of the road made it difficult to access the permit area shafts for the inspection.

Directly before heading up to the mine site I spoke with Dennis Ware over the phone. He did not accompany me up to the site, but gave me the go ahead for heading up there solo.

Inspector's Signature:

Keenan Storrar,  
Inspector ID Number: 71

Date Tuesday, October 04, 2016

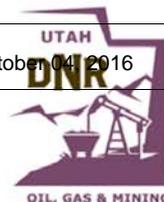

**REVIEW OF PERMIT, PERFORMANCE STANDARDS PERMIT CONDITION REQUIREMENTS**

1. Substantiate the elements on this inspection by checking the appropriate performance standard.
  - a. For COMPLETE inspections provide narrative justification for any elements not fully inspected unless element is not appropriate to the site, in which case check Not Applicable.
  - b. For PARTIAL inspections check only the elements evaluated.
2. Document any noncompliance situation by reference the NOV issued at the appropriate performance standard listed below.
3. Reference any narratives written in conjunction with this inspection at the appropriate performance standard listed below.
4. Provide a brief status report for all pending enforcement actions, permit conditions, Divison Orders, and amendments.

	Evaluated	Not Applicable	Comment	Enforcement
1. Permits, Change, Transfer, Renewal, Sale	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
2. Signs and Markers	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
3. Topsoil	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
4.a Hydrologic Balance: Diversions	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
4.b Hydrologic Balance: Sediment Ponds and Impoundments	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
4.c Hydrologic Balance: Other Sediment Control Measures	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
4.d Hydrologic Balance: Water Monitoring	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
4.e Hydrologic Balance: Effluent Limitations	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
5. Explosives	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
6. Disposal of Excess Spoil, Fills, Benches	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
7. Coal Mine Waste, Refuse Piles, Impoundments	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
8. Noncoal Waste	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
9. Protection of Fish, Wildlife and Related Environmental Issues	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
10. Slides and Other Damage	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
11. Contemporaneous Reclamation	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
12. Backfilling And Grading	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
13. Revegetation	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
14. Subsidence Control	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
15. Cessation of Operations	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
16.a Roads: Construction, Maintenance, Surfacing	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
16.b Roads: Drainage Controls	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
17. Other Transportation Facilities	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
18. Support Facilities, Utility Installations	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
19. AVS Check	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
20. Air Quality Permit	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
21. Bonding and Insurance	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
22. Other	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

**1. Permits, Change, Transfer, Renewal, Sale**

The mine has no permitting amendments under review with the Division at this time.

**3. Topsoil**

Topsoil placed across the two shaft sites is adequately stabilized with dense vegetation.

**13. Revegetation**

Dense vegetation covers the backfilled shafts.

**14. Subsidence Control**

The shafts appear to be visually stable. No subsidence cracks or sink holes were observed.

**21. Bonding and Insurance**

The mine is adequately covered by liability insurance with an effective policy period starting 12/13/2015 and expiring on 12/13/2016.

The mine is covered by a \$10,452 bond that will be eligible for Phase III release in 2018.