



State of Utah

DEPARTMENT OF NATURAL RESOURCES

MICHAEL R. STYLER
Executive Director

Division of Oil, Gas and Mining

JOHN R. BAZA
Division Director

Inspection Report

Permit Number:	C0250005
Inspection Type:	COMPLETE
Inspection Date:	Tuesday, August 13, 2019
Start Date/Time:	8/13/2019 9:00:00 AM
End Date/Time:	8/13/2019 3:00:00 PM
Last Inspection:	Tuesday, July 9, 2019

Representatives Present During the Inspection:	
Company	Kirk Nicholes
Company	Drew Christensen
OGM	Steve Demczak

Inspector: Steve Demczak

Weather: Sunny, 90's, Dry Conditions

InspectionID Report Number: 6501

Accepted by: SCHRISTE
9/10/2019

Permittee: **ALTON COAL DEVELOPMENT LLC**
 Operator: **ALTON COAL DEVELOPMENT LLC**
 Site: **COAL HOLLOW**
 Address: **463 North 100 West, Suite 1, CEDAR CITY UT 84720**
 County: **KANE**
 Permit Type: **PERMANENT COAL PROGRAM**
 Permit Status: **ACTIVE**

Current Acreages

1,017.15	Total Permitted
596.35	Total Disturbed
219.00	Phase I
77.00	Phase II
	Phase III

Mineral Ownership

- Federal
- State
- County
- Fee
- Other

Types of Operations

- Underground
- Surface
- Loadout
- Processing
- Reprocessing

Report summary and status for pending enforcement actions, permit conditions, Division Orders, and amendments:

The mine was active, auguring and shipping coal. The auguring was in Pit 19 see photos

Stephen J. Demczak

Inspector's Signature:

Steve Demczak,
Inspector ID Number: 39

Date Wednesday, August 21, 2019



REVIEW OF PERMIT, PERFORMANCE STANDARDS PERMIT CONDITION REQUIREMENTS

1. Substantiate the elements on this inspection by checking the appropriate performance standard.
 - a. For COMPLETE inspections provide narrative justification for any elements not fully inspected unless element is not appropriate to the site, in which case check Not Applicable.
 - b. For PARTIAL inspections check only the elements evaluated.
2. Document any noncompliance situation by reference the NOV issued at the appropriate performance standard listed below.
3. Reference any narratives written in conjunction with this inspection at the appropriate performance standard listed below.
4. Provide a brief status report for all pending enforcement actions, permit conditions, Divison Orders, and amendments.

	Evaluated	Not Applicable	Comment	Enforcement
1. Permits, Change, Transfer, Renewal, Sale	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
2. Signs and Markers	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
3. Topsoil	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
4.a Hydrologic Balance: Diversions	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
4.b Hydrologic Balance: Sediment Ponds and Impoundments	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
4.c Hydrologic Balance: Other Sediment Control Measures	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
4.d Hydrologic Balance: Water Monitoring	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
4.e Hydrologic Balance: Effluent Limitations	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
5. Explosives	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
6. Disposal of Excess Spoil, Fills, Benches	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
7. Coal Mine Waste, Refuse Piles, Impoundments	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
8. Noncoal Waste	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
9. Protection of Fish, Wildlife and Related Environmental Issues	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
10. Slides and Other Damage	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
11. Contemporaneous Reclamation	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
12. Backfilling And Grading	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
13. Revegetation	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
14. Subsidence Control	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
15. Cessation of Operations	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
16.a Roads: Construction, Maintenance, Surfacing	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
16.b Roads: Drainage Controls	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
17. Other Transportation Facilities	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
18. Support Facilities, Utility Installations	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
19. AVS check	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>
20. Air Quality Permit	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
21. Bonding and Insurance	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
22. Other	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>

1. Permits, Change, Transfer, Renewal, Sale

DOGM Permit – Expires on Nov 8, 2020 signed by both parties.
UPDES Permit- Expires on July 31, 2018. Permit number #Ut0025992 under evaluation
Air Quality Permit- DAQE-AN-1404700005-18
SPCC Plan was reviewed by P.E. on March 23, 2015
Business License - Cedar City, #138671
Storm Water – 17-85-015A

2. Signs and Markers

The identification sign was inspected and it meets the requirements of the R645 Coal Rules. See Photo

3. Topsoil

I inspected the topsoil piles and I did not see any signs of wind or water erosion. The topsoil piles appear to be stable and protected by a berm. See Photo

4.a Hydrologic Balance: Diversions

I inspected diversions and culverts throughout the property. They were open and would function as design during a storm event. The structures were recently re-graded and clean out of sediment. See photos

4.b Hydrologic Balance: Sediment Ponds and Impoundments

I inspected the sediment ponds throughout the property. They contained some water but were not discharging. It is unlikely these structures will discharge in the near future. The embankments appear to be stable. Inlets and outlets would function as design. I did not see any hazardous conditions to these structures. The permittee conducted a second quarter sediment pond inspections on June 18, 2019. No hazardous conditions were reported.

4.c Hydrologic Balance: Other Sediment Control Measures

Silt fences, waddles, and straw bales were inspected and comply with the requirement of the R645 Coal Rules.

4.d Hydrologic Balance: Water Monitoring

Water monitoring information is taken by the permittee and is sent electronically to the Division in Salt Lake City. This information is reviewed and analyzed by the Division staff. A report is written.

4.e Hydrologic Balance: Effluent Limitations

The permittee was in compliance with the UPDES permit for the second quarter.

5. Explosives

6. Disposal of Excess Spoil, Fills, Benches

Spoil is getting place from Pits 11 through Pits 18. Pits 11 through pit 15 are getting graded.

7. Coal Mine Waste, Refuse Piles, Impoundments

I inspected the refuse pile and it appears to be stable. I did not notice any hazardous conditions to the embankments. The refuse pile is active. The permittee conducted a second quarter refuse pile inspection on June 18, 2019. This document is P.E. certified. No hazardous conditions were reported. See Photos

8. Noncoal Waste

The site was clean of non-coal waste materials such as trash, oil cans, wood and scrap materials.

10. Slides and Other Damage

No slides or other damage was noticed at the highwall. Some areas the highwall was seeping water.

12. Backfilling And Grading

The permittee is currently finishing backfilling Pits 11 through 15.

16.a Roads: Construction, Maintenance, Surfacing

The roads were compacted with no dust control problem. The roads were wet and had been recently water.

16.b Roads: Drainage Controls

I inspected the road diversions and culverts throughout the property. They were functioning as design. See Photos

18. Support Facilities, Utility Installations

No new facilities constructed since the last inspection.

19. AVS check

AVS checks are made in Salt Lake City.















COAL HOLLOW MINE
463 NORTH 100 WEST
CEDAR CITY UT
84721
435-867-5331
MSHA ID NUMBER
42-02519
MINE PERMIT NUMBER
C/025/0005



Altrix Coal
Development






COAL HOLLOW MINE
463 NORTH 100 WEST
CEDAR CITY UT
84721
435-867-5331
MSHA ID NUMBER
42-02519
MINE PERMIT NUMBER
C/025/0005






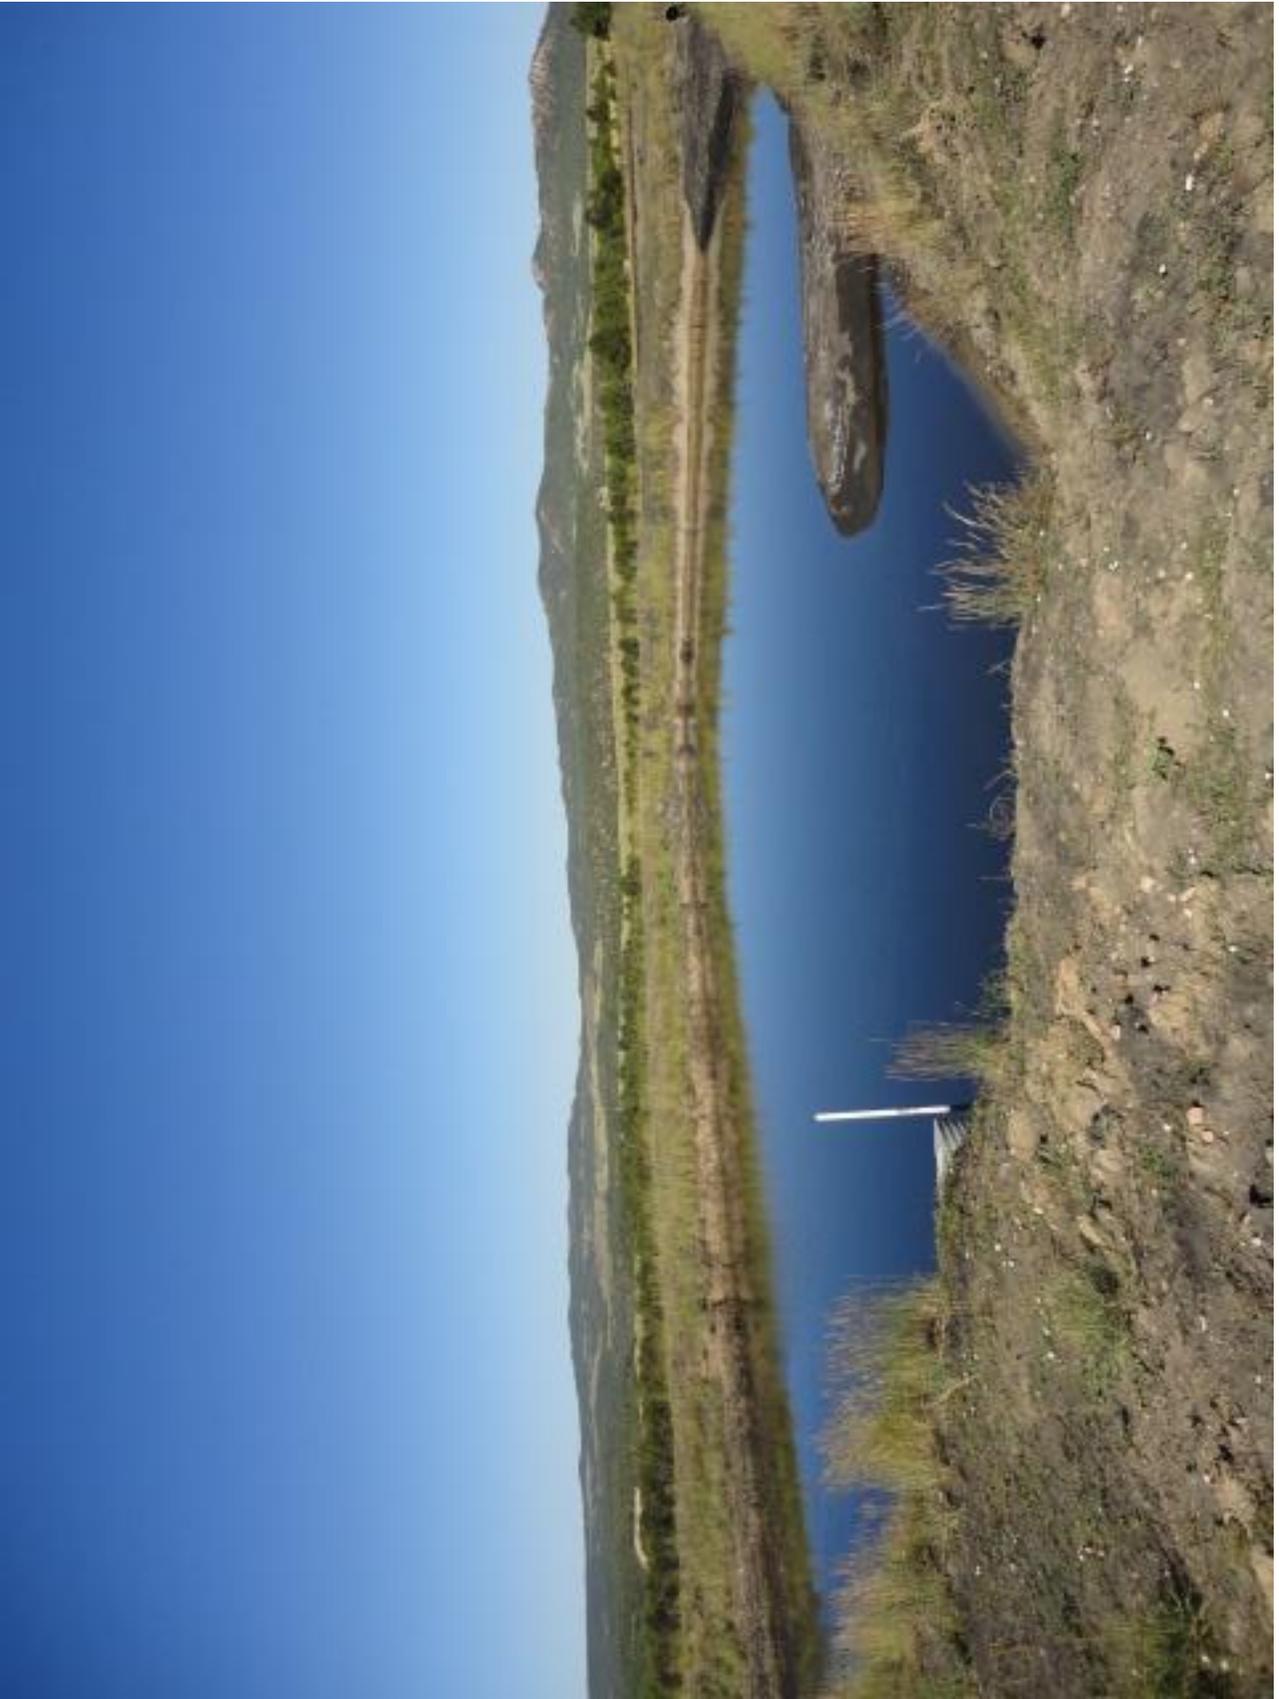







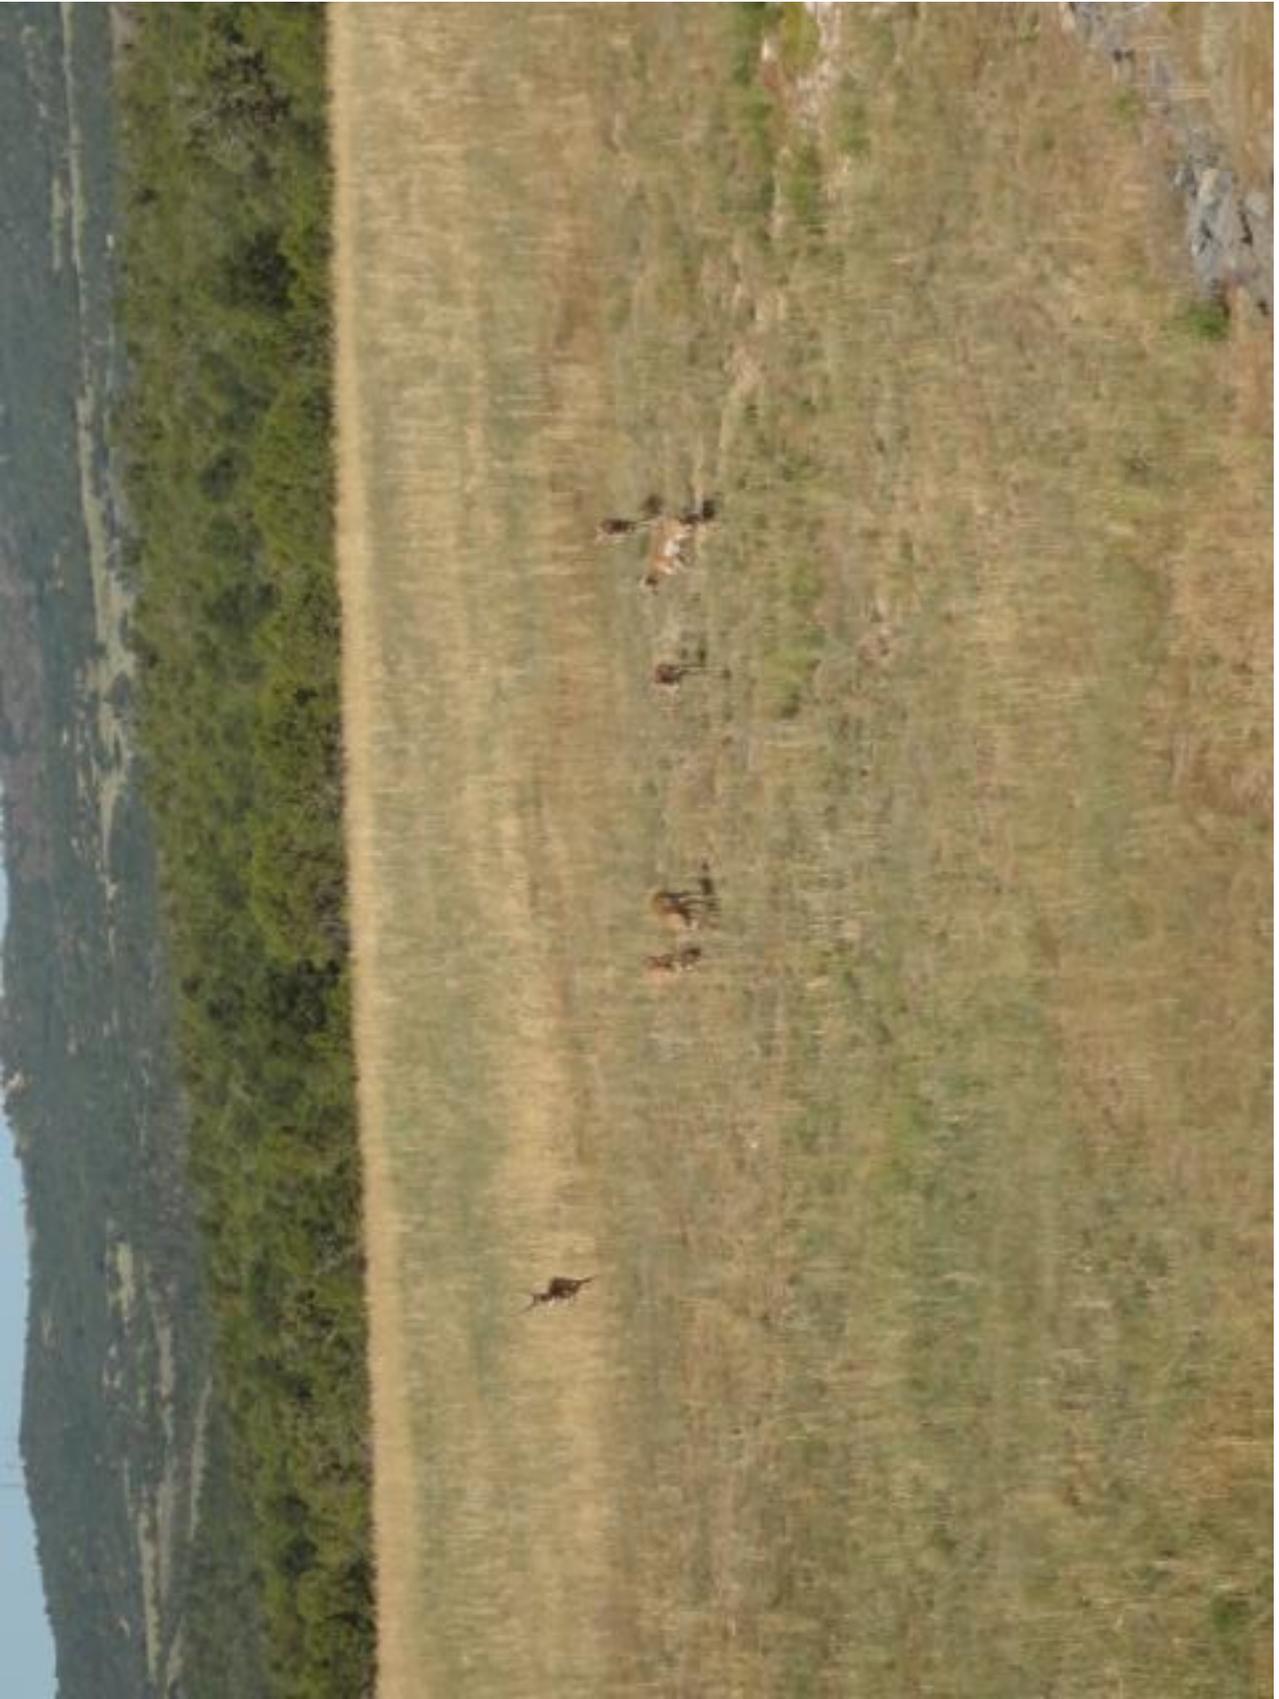











**COAL HOLLOW MINE
463 NORTH 100 WEST
CEDAR CITY UT**

84721

435-867-5331

MSHA ID NUMBER

42-02519

MINE PERMIT NUMBER

C/025/0005



**ALTON COAL
DEVELOPMENT**



















